

VISUAL COMFORT & Co.


ARCHITECTURAL COLLECTION

GENERAL PRODUCT INFORMATION:


This product is suitable for dry locations only.



This product must only be used with Generation Brands low-voltage systems.

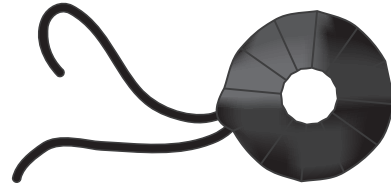


Install the Dimming Coil in Surface 150 Watt Transformers

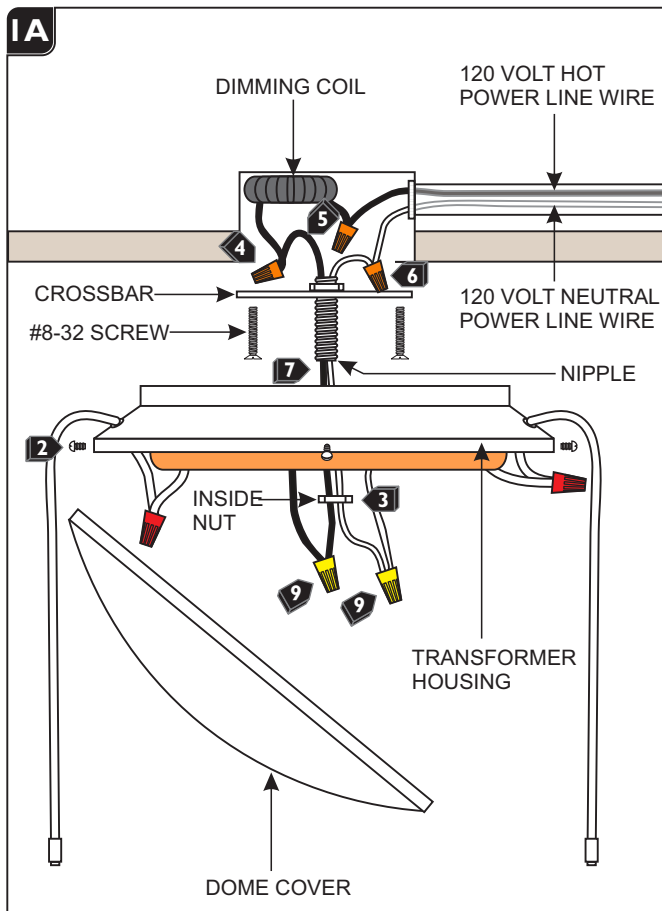


- 1** Turn the power to the electrical box off.
- 2** On side of the transformer canopy, remove the #4-40 Phillips head screws and lift the dome cover off.
- 3** Loosen the inside nut and remove the crossbar with the attached nipple.
- 4** Connect one dimming coil wire to the 120 volt hot power line wire with a wire nut.
- 5** Connect the other dimming coil wire to the black extension wire with a wire nut.
- 6** Connect the 120 volt neutral power line wire to the white extension wire with a wire nut.
- 7** Feed the extension wires through the nipple attached to the crossbar and mount the crossbar to the electrical box with the two #8-32 screws.
- 8** Slip the transformer housing onto the nipple and secure it with the inside nut.
- 9** Connect the black and white extension wire to the black and white 120 volt transformer wires respectively with wire nuts.
- 10** Refer to the instructions provided with the surface mount transformers to complete the installation.

Install the Dimming Coil in All Other Surface Transformers

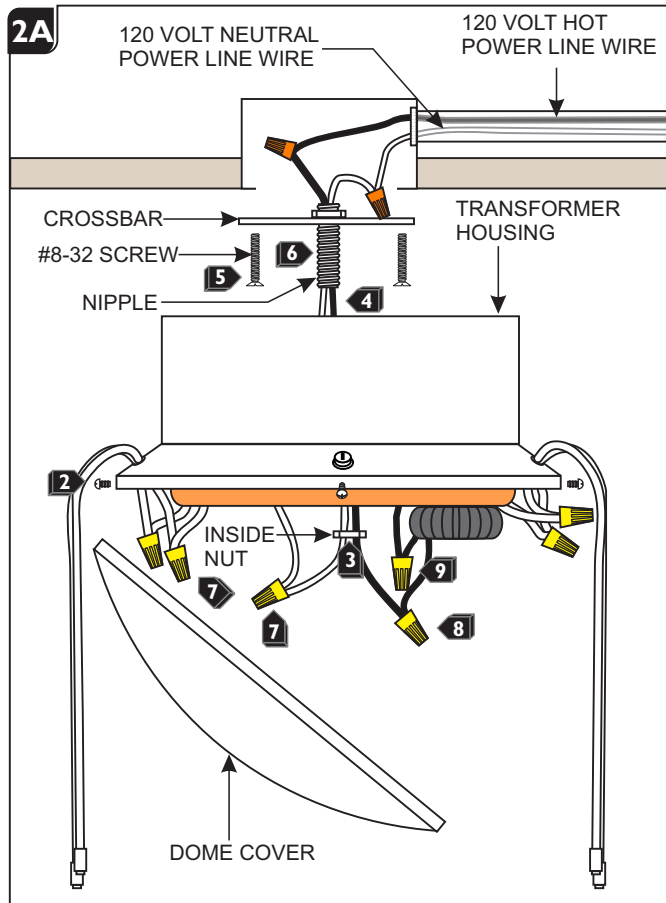

- 1 Turn the power to the electrical box off.
- 2 On side of the transformer canopy, remove the #4-40 Phillips head screws and lift the dome cover off.
- 3 Loosen the inside nut and remove the crossbar with the attached nipple.
- 4 Connect the black and white extension wires to the hot and neutral power line wires respectively with wire nuts.
- 5 Feed the extension wires through the nipple attached to the crossbar and mount the crossbar to the electrical box with the two #8-32 screws.
- 6 Slip the transformer housing onto the nipple and secure it with the inside nut.
- 7 Connect the white extension wire to the 120 volt white transformer wire with a wire nut.
- 8 Connect the black extension wire to one of the dimming coil wire (either one) with a wire nut.
- 9 Connect the other dimming coil wire to the 120 volt black transformer wire with a wire nut.
- 10 Refer to the instructions provided with the surface mount transformers to complete the installation.

Install the Dimming Coil in Remote Magnetic Transformers

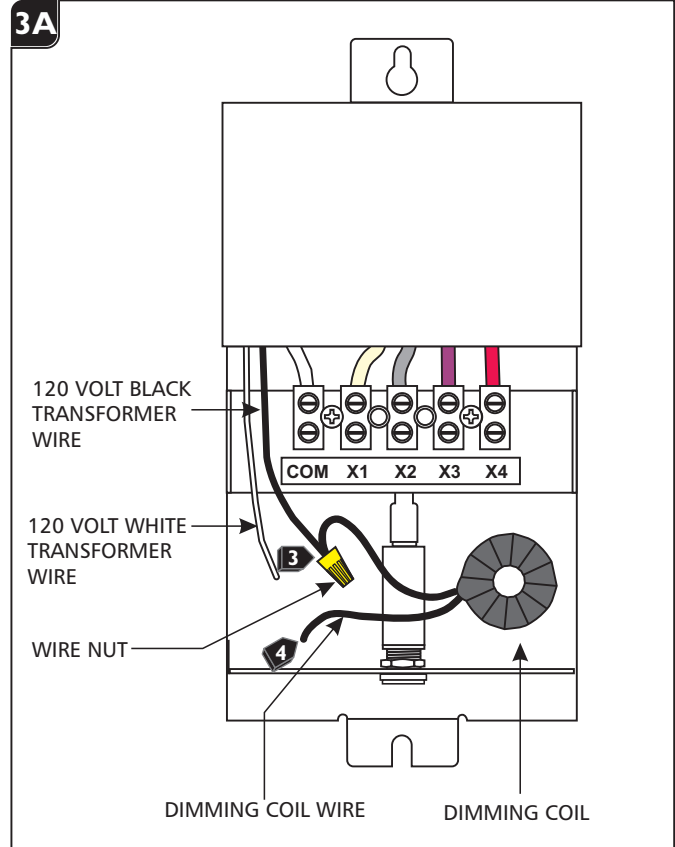

- 1 Remove transformer cover by loosening the two Phillips screws on the side of the transformer.
- 2 Locate the 120 volt transformer black and white wires.
- 3 Connect one dimming coil wire (either one) to the 120 volt black transformer wire with a wire nut.
- 4 The other dimming coil wire will be used as 120 Volt black transformer wire for power connection. Refer to the instruction provided with the remote transformer.

SAVE THESE INSTRUCTIONS!