Tools and Material Not Supplied

Pipe dope Tape measure Screwdriver Level

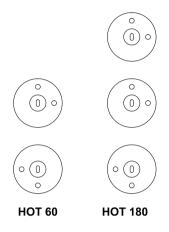


fig 1. Bracket Positions

Assembly Instructions

Sufficient quality pipe dope must be applied to valve- tail threads prior to their installation.

Install the valves using the (1 / 2 inch) Allen Wrench Install Air Vent (A).

Connect the radiator to heating circuit with air vent on the return.

Accurately mark the bracket holes on the wall using a level, to dimensions shown on the SPECIFICATION DATA sheet. Depending on the radiator height, drill two or three pilot

holes.If wall is hollow sheetrock, drill $\frac{5}{16}$ " hole for toggle bolts (H).

Attach brackets (C) to the wall with screws (D) if wall is solid. If hollow wall use the toggle bolts (H).

Position brackets (C) on the wall with screw holes as shown in figure 1 for maximum rigidity before tightening the screws (D).

Hang the radiator onto brackets (C) by inserting the lugs into the brackets.

Tighten Allen Screws (E) with Allen Wrench (F).

Hot Hot Hardware Supplied 60 180 Air Vent - 1 / 4 inch Α В Wall Plug 2 3 С Bracket 2 3 Screw - Round Head 3 7mm Dia x 70 mm 6 Е Allen Screw F Allen Wrench - 3mm 1 G Allen Wench - 1 / 2 inch 1 н Toggle Kit 1

Valve Set

